

Leak Report



Project Info

Project Name: S532 ÖRNEK HAVA KAÇAK RAPORU
Customer: XXXXXXXXXXXX
Address: XXXXXXXXXXXX
İSTANBUL
TÜRKİYE
Start Date: 2024-11-06
End Date: 2024-11-08

Service Company

Name: NESKA OTOMASYON
Address: Halil Rifat Paşa Mh. Yüzer Havuz Sk. NO:1, Şişli
İSTANBUL
TÜRKİYE
Contact: info@neskaotomasyon.com
0212 401 0689

Project Summary


Total Number of Leaks:	11
Total estimate losses:	372.66 l/min
Total estimate costs/year:	3917 EUR
Operating hours/year:	8760 hour(s)
Cost/1000m3:	20.00 EUR

Leak Statistics

Location Statistics


Location	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
MAKİNA 1	1	49.98	525
PANO İÇİ	1	54.22	570
PANO ÇIKIŞI	2	36.70	386
MAKİNA 5	1	36.78	387
MAKİNA 8 PANO ÜSTÜ	1	23.37	246
MAKİNA 5 ÜSTÜ	1	38.37	403
MAKİNA 3 ÜSTÜ	1	34.04	358
KURUTMA TÜPÜ	1	45.05	474
MAKİNA 11	1	30.79	324
MAKİNA 11 ÜSTÜ	1	23.35	245

Leak losses by location

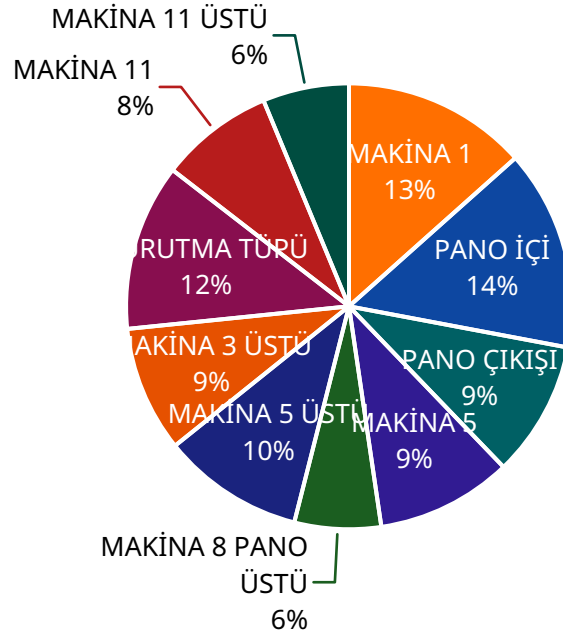

Group Statistics


Group	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
SARIM	1	49.98	525
HORTUM GRUBU	3	99.12	1042
RAKOR	2	45.97	483
BASIÇLI HAVA GİRİŞİ	1	36.78	387
BASINÇLI HAVA HATTI	2	72.41	761
TÜP ÜSTÜ RAKOR	1	45.05	474
HAVA HATTI VANA GRUBU	1	23.35	245

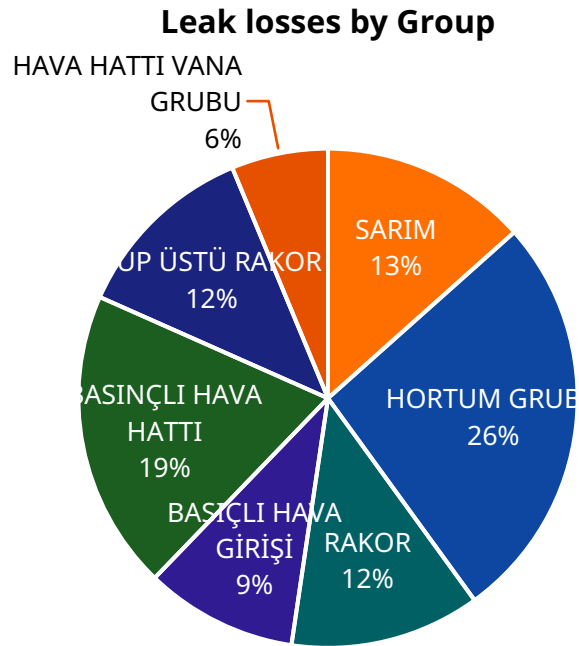

Leak Grade Statistics


Grade Level	Number of leaks	Leak losses(l/min)	Leak costs(EUR)
Level 0	0	0.00	0
Level 1	0	0.00	0
Level 2	0	0.00	0
Level 3	0	0.00	0
Level 4	11	372.66	3917

Leak losses by Grade

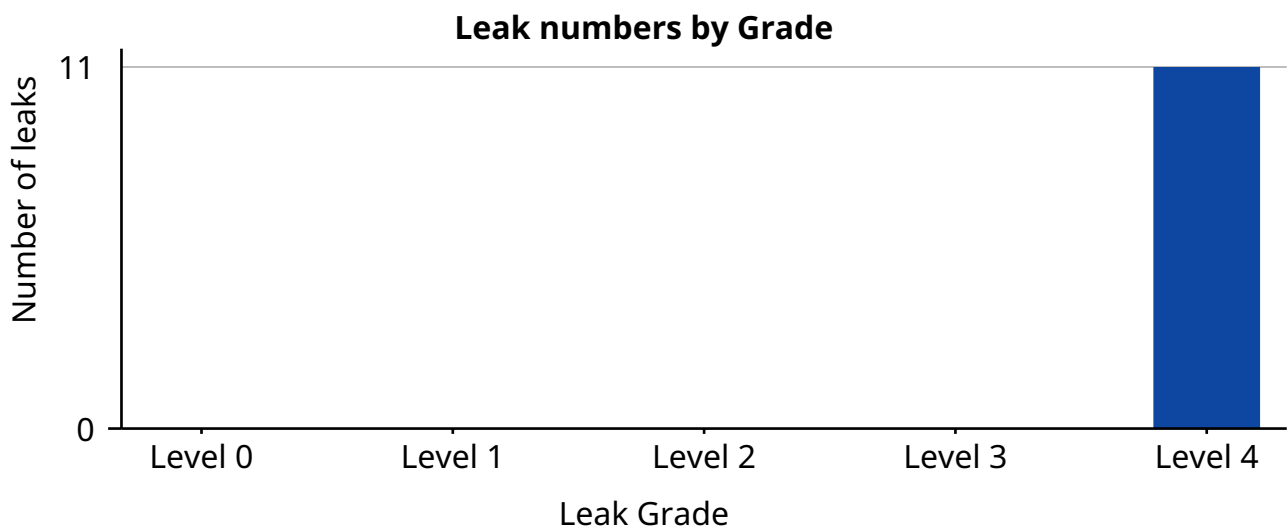

List of Leakages

Tag	Leak Info	Losses
027	Location: MAKİNA 1 Group: SARIM Grade: 4 Distance: 1.0 m Recorded: 2024-11-06	50.0 l/min 525 EUR/year Sound Level: 75.9 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	

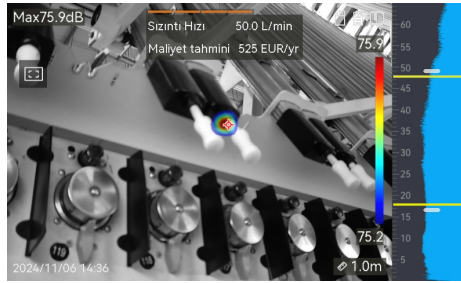

Tag	Leak Info	Losses
028	Location: PANO İÇİ Group: HORTUM GRUBU Grade: 4 Distance: 1.0 m Recorded: 2024-11-06	54.2 l/min 570 EUR/year Sound Level: 66.0 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	



Tag	Leak Info	Losses
029	Location: PANO ÇIKIŞI Group: RAKOR Grade: 4 Distance: 1.0 m Recorded: 2024-11-06	22.6 l/min 238 EUR/year Sound Level: 48.5 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	



Tag	Leak Info	Losses
030	Location: PANO ÇIKIŞI Group: HORTUM GRUBU Grade: 4 Distance: 1.0 m Recorded: 2024-11-06	14.1 l/min 148 EUR/year Sound Level: 55.6 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	



Tag	Leak Info	Losses
031	Location: MAKİNA 5 Group: BASIÇLI HAVA GİRİŞİ Grade: 4 Distance: 1.0 m Recorded: 2024-11-06	36.8 l/min 387 EUR/year Sound Level: 65.6 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	




Tag	Leak Info	Losses
032	Location: MAKİNA 8 PANO ÜSTÜ Group: RAKOR Grade: 4 Distance: 1.0 m Recorded: 2024-11-06	23.4 l/min 246 EUR/year Sound Level: 52.1 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	



Tag	Leak Info	Losses
033	Location: MAKİNA 5 ÜSTÜ Group: BASINÇLI HAVA HATTI Grade: 4 Distance: 8.0 m Recorded: 2024-11-06	38.4 l/min 403 EUR/year Sound Level: 55.5 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	




Tag	Leak Info	Losses
034	Location: MAKİNA 3 ÜSTÜ Group: BASINÇLI HAVA HATTI Grade: 4 Distance: 8.0 m Recorded: 2024-11-06	34.0 l/min 358 EUR/year Sound Level: 57.2 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	

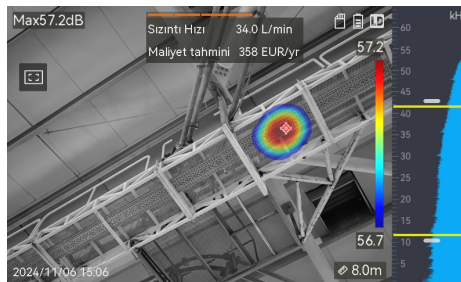

Tag	Leak Info	Losses
035	Location: KURUTMA TÜPÜ Group: TÜP ÜSTÜ RAKOR Grade: 4 Distance: 8.0 m Recorded: 2024-11-06	45.1 l/min 474 EUR/year Sound Level: 64.1 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	



Tag	Leak Info	Losses
036	Location: MAKİNA 11 Group: HORTUM GRUBU Grade: 4 Distance: 8.0 m Recorded: 2024-11-06	30.8 l/min 324 EUR/year Sound Level: 62.1 dB Last updated: 2024-11-08
Notes:	KONTROL VEYA DEĞİŞİM ÖNERİLİR.	

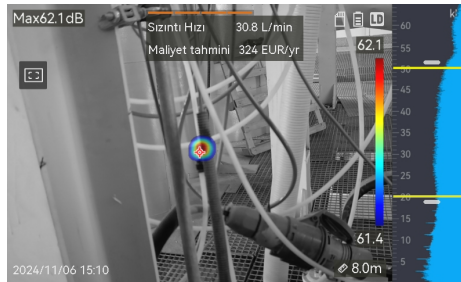

Tag

037

Leak Info

Location: MAKİNA 11 ÜSTÜ
Group: HAVA HATTI VANA GRUBU
Grade: 4 Sound Level:
Distance: 8.0 m
Recorded: 2024-11-06 Last updated: 2024-11-08

Losses

23.4 l/min
245 EUR/year
36.0 dB

Notes: KONTROL VEYA DEĞİŞİM ÖNERİLİR.



Notes/Additional Info
